



**LADSAF EQUIPMENT
REPLACEMENT REPORT**



Job Location	Sample Site Site# 000-0001	Technician Name	Entropy Tech Services p 0400 122 157 www.entropy.info
Completion Date	April 2016	Technician Sign Off	XXXXXX

Part Replaced	Replaced Yes/No	Issues to note	Part Number
Top Bracket and Cap:	Yes	T.B. replaced due to internals corroded due to water ingress thru hole in top cap.	LS-B kit Gal Steel T.B.& Cap.
Bottom Bracket and Tension Ring:	Yes	B.B replaced due to corrosion on tension washers, nut and bracket. *Previous bottom bracket installed upside down on ladder.	LS-B kit Gal Steel B.B. & Ring.
Cable:	Yes	Original cable in serviceable condition therefore re-used.	LS001-1/19-G LADSAF Cable Gal.Steel 10mm Dia.
Cable Guides:	Yes	2x cable guides installed as none previously installed.	#6100540
Inspection Plate Stamped:	Yes	Inspection plate stamped in and new parts inspected and passed for service. All Clear	N/A





LADSAF Replacement Supporting Images




Before Images:



After Images:



Non-conformance issue rectified:

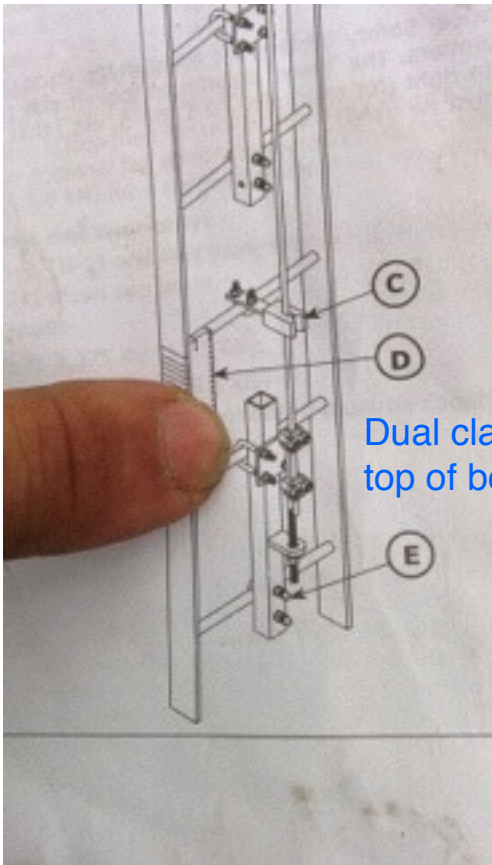

Dual clamp should be at top of bottom bracket.



Previous install was at bottom (inverted).

Replacement bottom bracket installed with correct orientation.

